

# 3M™ No Polish FA-SC Connector 8801

## No Polish Connector SC/APC Flat Splice for FRP 8801-APC/FS

### Instructions

No Polish FA-SC Connector 8801 with a SC/UPC interface and No Polish Connector SC/APC flat splice 8801-APC/FS can be used with 500µm or 250µm coated fiber in FRP style cable.

#### Termination Tools Required

Cleaver, Scissors/ Snips, Fiber Holder 8811-FH, Fiber Stripping Tool 8811-ST, Lint Free Cloth, and 99% pure Isopropyl Alcohol are required separately. The Actuation Tool is provided in every box of connectors. A Cable Slitting Tool is required when using oval shaped FRP cable.

**Note:** Gel inside the connector may cause minimal eye irritation. Contains phenylmethyl silicone (63148-58-3) and hydrophobic silica (68611-44-9). Avoid eye contact, wash hands before eating or smoking. Carefully follow safety, health and environmental information given on the product label or the MSDS sheet for the connector.

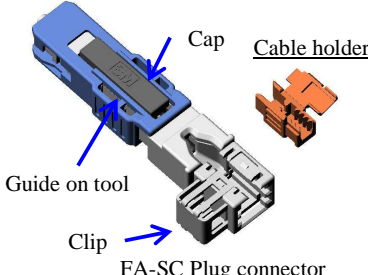
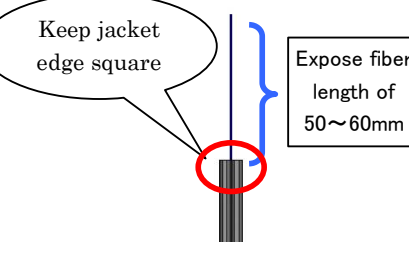
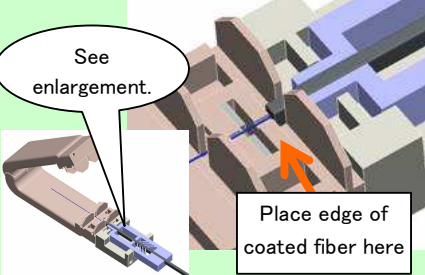
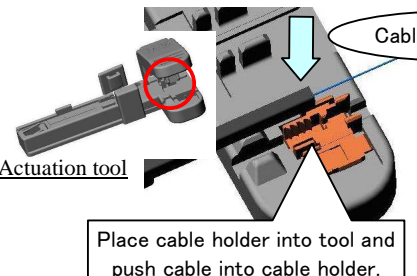
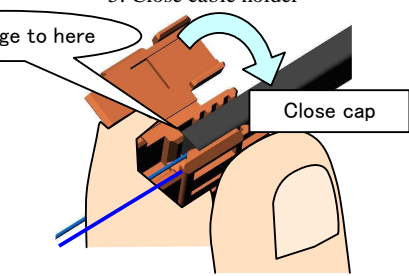
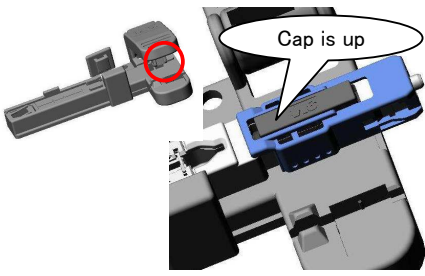
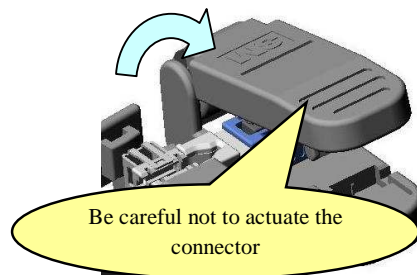
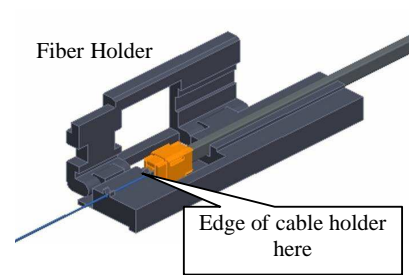
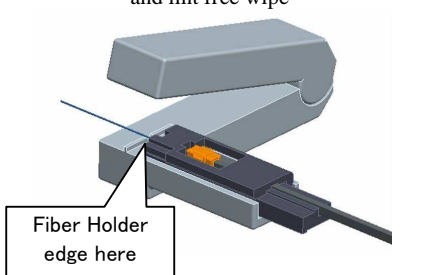
**Emergency phone: 1-800-364-3577 or (651) 737-6501 (24 hours).**

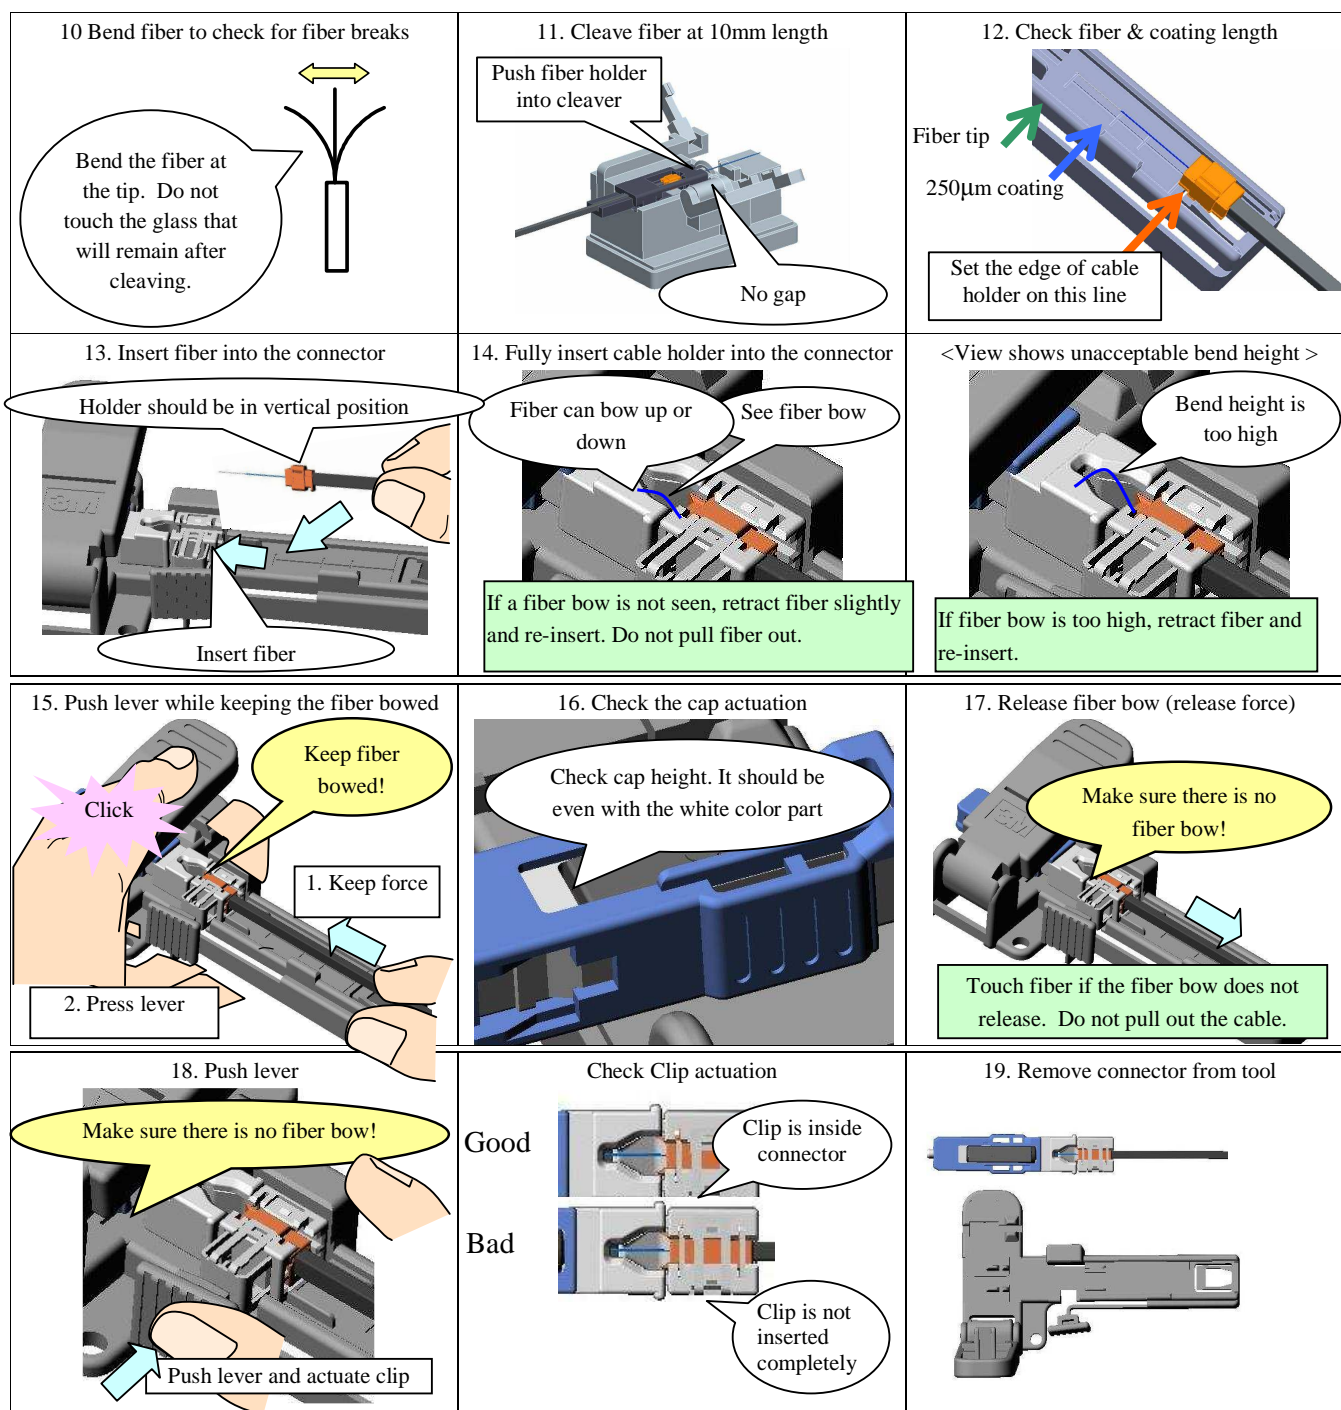
#### CAUTION

Safety glasses should be worn while working around optical fibers. Do not view fiber ends if they are illuminated with a laser. Carefully follow safety, health and environmental information on the label or MSDS for isopropyl alcohol. Store, use and dispose of isopropyl alcohol per your company policy.

#### Instructions

 or  shows an assembly step and  shows a key point in the assembly process.

|  |  |   |
|--|--|---|
| <p>1. Components</p>                          | <p>2. Separate cable jacket from the fiber and trim jacket material with scissors or snips.</p>  | <p>3. Strip 500µm coating (500µm fiber only)</p>                         |
| <p>4. Assemble cable in the cable holder</p>  | <p>5. Close cable holder</p>   | <p>6. Place connector in the tool</p>                                    |
| <p>7. Close lever slightly</p>                | <p>8. Place cable and holder into the fiber holder</p>   | <p>9. Strip fiber coating and clean with alcohol and lint free wipe</p>  |



3M is a trademark of 3M Company.

#### Important Notice

All statements, technical information, and recommendations related to 3M's products are based on information believed to be reliable, but the accuracy or completeness is not guaranteed. Before using this product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use. Any statements related to the product which are not contained in 3M's current publications, or any contrary statements contained on your purchase order shall have no force or effect unless expressly agreed upon, in writing, by an authorized officer of 3M.

#### Warranty; Limited Remedy; Limited Liability.

This product will be free from defects in material and manufacture for a period of one (1) year from the time of purchase. **3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.** If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. **Except where prohibited by law, 3M will not be liable for any indirect, special, incidental or consequential loss or damage arising from this 3M product, regardless of the legal theory asserted.**



Communication Markets Division

3M Telecommunications

6801 River Place Blvd.

Austin, TX 78726-9000

1-800-426-8688

[www.3MTelecommunications.com](http://www.3MTelecommunications.com)

© 3M 2008. All Rights Reserved.

78-8140-3785-5